

JIS

JAPANESE INDUSTRIAL STANDARD

Care labelling of textile goods

JIS L 0217—1995

Translated and Published

by

Japanese Standards Association

Printed in Japan



Documents

Document Sharing Hub

8 S

In the event of any doubt arising,
the original Standard in Japanese is to be final authority.



JAPANESE INDUSTRIAL STANDARD

J I S

Care labelling of textile goods

L 0217-1995

1. Scope This Japanese Industrial Standard specifies the labelling symbols (hereafter referred to as "symbols") and labelling methods for textile goods in order to instruct the proper handling of them for home laundering.

Remarks 1. The following standards are cited in this Standard:

- JIS C 9203 Electric irons
- JIS C 9606 Electric washing machines
- JIS K 2201 Gasoline for industrial purpose
- JIS K 3303 Laundry powdered soaps
- JIS K 3371 Synthetic detergents for home laundering
- JIS L 0803 Standard adjacent fabrics for staining of colour fastness test
- JIS L 0821 Apparatus for testing of colour fastness to washing
- JIS L 0856 Testing methods for colour fastness to bleaching with hypochlorite
- JIS L 0860 Testing method for colour fastness to dry cleaning
- JIS L 1096 Testing methods for woven fabrics

2. The International Standard corresponding to this Standard is shown below:

ISO 3758: 1991 Textiles - Care labelling code using symbols

2. Symbols

2.1 Classification Symbols shall be classified into the following 6 categories:

- (1) Washing (with water)
- (2) Possibility of chlorine-based bleaching
- (3) Ironing
- (4) Dry-cleaning
- (5) Wringing
- (6) Drying



Documents
Document Sharing Hub

2
L 0217-1995

2.2 Numbers, symbols, and meaning of symbols The numbers, symbols, and meaning of the symbols shall be as shown in Tables 1 to 6:

Table 1. Washing (with water)

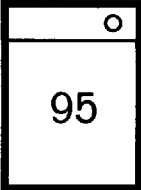
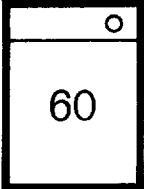
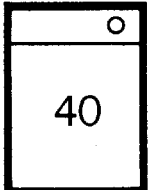
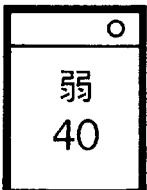
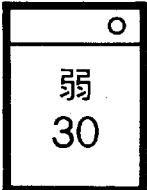
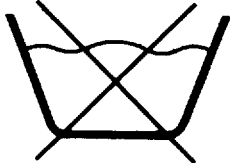
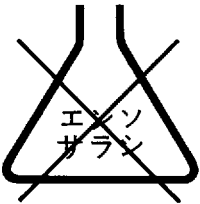
Number	Symbol	Meaning of symbol
101		The temperature limit shall be 95°C. Washable.
102		The temperature limit shall be 60°C. Machine washable.
103		The temperature limit shall be 40°C. Machine washable.
104		The temperature limit shall be 40°C. Should be washed with slow water current by machine or gently by hand ⁽¹⁾ . Informative reference: 弱 means "gently".
105		The temperature limit shall be 30°C. Should be washed with slow water current by machine or gently by hand ⁽¹⁾ . Informative reference: 弱 means "gently".

Table 1. (continued)

Number	Symbol	Meaning of symbol
106		The temperature limit shall be 30°C. Should be washed gently by hands ⁽¹⁾ (not machine washable). Informative reference: 手洗い means "wash by hands".
107		Cannot be washed with water.

Note (1) Gently washing by hand is classified into wash by shaking, wash by pushing and wash by grasping.

Table 2. Possibility of chlorine-based bleaching

Number	Symbol	Meaning of symbol
201		Chlorine-based bleaching allowed. Informative reference: エンソ・サラシ means "chlorine-based bleaching".
202		Do not use chlorine-based bleach.